

Model Communiqué

Hawker Series


All Hawker 125 Series Aircraft

**Communiqué # HK-0038
November, 2011**

ATA 26 - Fire Protection - Electrical Wire Protection Kit

Hawker Beechcraft Corporation (HBC) is issuing this Model Communiqué to inform owners, operators, and service centers of a chafing condition that could exist between the fairlead wire cover blankets mounting hardware and the engine inlet assemblies.

The clamps that mount the fairlead wire cover blankets may be disturbed during routine maintenance in the area. Sometimes, the tails of the clamp are pulled away from the body, resulting in the flared tail coming into contact with the engine inlet assembly. Continued contact may result in chafing to the inlet assembly. HBC recommends that extra care be taken to ensure the clamp tails are secured against the clamp body to avoid potential contact with the engine inlet assembly.

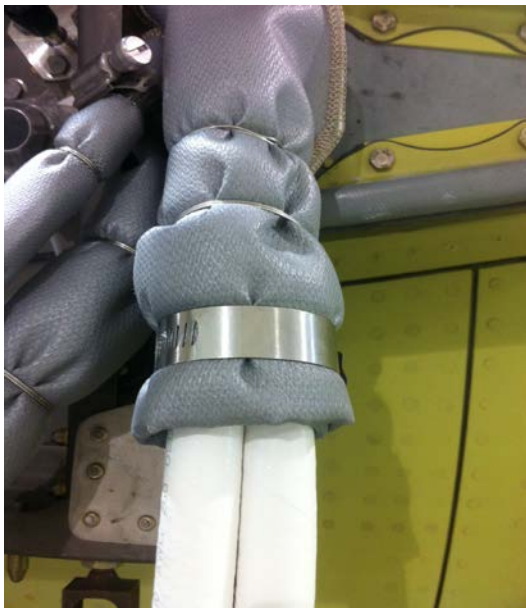

Contact Hawker Beechcraft Customer Support at 1-800-429-5372 or 1-316-676-3140 with any questions or concerns.